

## Oconee 3

### 1Q/2003 Plant Inspection Findings

---

#### Initiating Events

---

#### Mitigating Systems

**Significance:**  Dec 31, 2002

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

##### **Failure to Perform Surveillance within the Required Periodicity**

An inadequacy in the licensee's work planning program resulted in a missed Technical Specification (TS) required surveillance test involving the Keowee Hydro Station overhead power path. A non-cited violation of TS surveillance requirements (SR) 3.3.19.1, Channel Functional Test for Degraded Grid Voltage Protection Actuation Logic Channels, SR 3.8.1.15, 230kV Circuit Breaker Actuation on Switchyard Isolation, and TS 5.5.18, Keowee Hydro Unit Commercial Power Generation Testing Program, was identified when it was discovered that PT/0/A/610/022, Keowee Over Frequency Protection Functional Test, was not performed within the required TS SR frequency. This violation is more than minor because it affected the mitigating system cornerstone objective of equipment reliability, in that, a complex series of tests for the emergency power supply were not performed within the specified frequency. This self-revealing finding was determined to be of very low safety significance based on the fact that there was no unavailability of the Keowee units resulting from the missed surveillances. (Section 1R22.2)

Inspection Report# : [2002005\(pdf\)](#)

**Significance:**  Nov 21, 2002

Identified By: Self Disclosing

Item Type: VIO Violation

##### **Failure to Properly Install Electrical Connectors on High Pressure Injection Pump Temporary Power Supply Cables**

Contrary to Technical Specification 5.4.1, which requires that written procedures recommended in Regulatory Guide 1.33 shall be implemented, the licensee failed to adequately implement the vendor's written instructions for attaching the "Elastimold" electrical connectors on the "Black" and "Red" phases of the Unit 3 high pressure injection (HPI) pump emergency power supply cable from the auxiliary service water switchgear. Consequently, the "Elastimold" connectors on these two phases were found to be improperly installed (i.e., not screwed on), resulting in the possible loss of HPI pump function during a postulated high energy line break/tornado event recovery.

Inspection Report# : [2003007\(pdf\)](#)

Inspection Report# : [2003008\(pdf\)](#)

**Significance:**  Sep 28, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

##### **Unauthorized Design Changes to the East Penetration Room Blowout Panels**

The inspectors identified a non-cited violation for the unauthorized design changes to the east penetration room blowout panels which changed the blowout panel design capability to remove water from the auxiliary building following a postulated main feedwater line rupture. This issue was considered to be of very low safety significance because at least one train of emergency feedwater would have been available during all of the accident sequences of concern. (Section 4OA5)

Inspection Report# : [2002004\(pdf\)](#)



**Significance:** Jun 29, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

**Failure to Complete a Timely Operability Evaluation for Failure of Non-Seismic Piping in the Control Rooms**

A non-cited violation was identified for a failure to promptly identify conditions adverse to quality by completing the operability evaluation following identification that non-seismic piping was located in the ceiling of the shared control room for Units 1 and 2. The licensee was developing a modification package to remove the non-seismic piping from the control room. This issue was considered to be of very low safety significance because of the low probability of piping failure and the ability of the operators to evacuate the control room and successfully shutdown Units 1 and 2 from the remote shutdown stations (Section 4OA5.1).

Inspection Report# : [2002002\(pdf\)](#)



**Significance:** May 03, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

**Inadequate Testing of Pressurizer Code Safety Valves**

Inadequate Testing of Pressurizer Code Safety Valves (Section 02.03B.(8))

Inspection Report# : [2002007\(pdf\)](#)

---

## Barrier Integrity



**Significance:** Jun 29, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

**Failure to Follow Procedures Resulting in Conducting Penetrant Examination on the Wrong Weld**

A non-cited violation was identified for a failure to assure that a Penetrant Examination (PT) was performed on the correct weld or component in accordance with requirements of Technical Specification (TS) 5.4.1, which requires the use of written procedures; specifically in this case, Procedure NDE-35 and Drawing No. ISI OCN 1-009, Reactor Coolant Pump 1B1 Suction Piping. This finding was of very low safety significance because, although the inspectors identified that the licensee examiners performed the PT on the wrong weld, the PT was subsequently performed on the correct weld and found to be acceptable (Section 1R08).

Inspection Report# : [2002002\(pdf\)](#)

---

## Emergency Preparedness

---

## Occupational Radiation Safety

---

## Public Radiation Safety

---

## Physical Protection

---

## Miscellaneous

**Significance:** SL-IV Jul 26, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

**Failure to Update the FSAR Regarding Portions of the HPSW Piping in the Auxiliary Building**

Contrary to 10 CFR 50.71(e), the licensee failed to update the FSAR regarding portions of the HPSW piping in the Auxiliary Building. [NOTE: Per the ROP, this type of issue is not evaluated through the SDP; but rather, it is to be evaluated in accordance with the guidance in Section IV.A.3 of the NRC Enforcement Policy. Accordingly, the NRC determined that this violation should be characterized at Severity Level IV due to its low safety significance and because the particular regulatory process was not significantly impeded. Additionally, it was also determined that this violation should be non-cited in accordance with Section VI.A.1 of the NRC's Enforcement Policy.]

Inspection Report# : [2002011\(pdf\)](#)

Last modified : May 30, 2003